



# Upínač pro nástrčné frézy - kombi

## Combi shell mill holders



DIN 6358

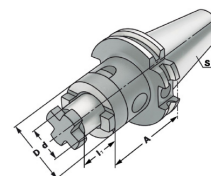

Název Catalog number	Kužel Taper	d	D	A	l <sub>1</sub>		G 6,3 15.000 min <sup>-1</sup>
SK40.55.NK.16.ADB	SK40	16	32	55	17	AD/B	•
SK40.55.NK.22.ADB	SK40	22	40	55	19	AD/B	•
SK40.55.NK.27.ADB	SK40	27	48	55	21	AD/B	•
SK40.60.NK.32.ADB	SK40	32	58	60	24	AD/B	•
SK40.60.NK.40.ADB	SK40	40	70	60	27	AD/B	•
SK40.100.NK.16.ADB	SK40	16	32	100	17	AD/B	•
SK40.100.NK.22.ADB	SK40	22	40	100	19	AD/B	•
SK40.100.NK.27.ADB	SK40	27	48	100	21	AD/B	•
SK40.100.NK.32.ADB	SK40	32	58	100	24	AD/B	•
SK40.100.NK.40.ADB	SK40	40	70	100	27	AD/B	•
SK40.160.NK.16.ADB	SK40	16	32	160	17	AD/B	•
SK40.160.NK.22.ADB	SK40	22	40	160	19	AD/B	•
SK40.160.NK.27.ADB	SK40	27	48	160	21	AD/B	•
SK40.160.NK.32.ADB	SK40	32	58	160	24	AD/B	•
SK40.160.NK.40.ADB	SK40	40	70	160	27	AD/B	•
SK50.55.NK.16.ADB	SK50	16	32	55	17	AD/B	•
SK50.55.NK.22.ADB	SK50	22	40	55	19	AD/B	•
SK50.55.NK.27.ADB	SK50	27	48	55	21	AD/B	•
SK50.55.NK.32.ADB	SK50	32	58	55	24	AD/B	•
SK50.55.NK.40.ADB	SK50	40	70	55	27	AD/B	•
SK50.100.NK.16.ADB	SK50	16	32	100	17	AD/B	•
SK50.100.NK.22.ADB	SK50	22	40	100	19	AD/B	•
SK50.100.NK.27.ADB	SK50	27	48	100	21	AD/B	•
SK50.100.NK.32.ADB	SK50	32	58	100	24	AD/B	•
SK50.100.NK.40.ADB	SK50	40	70	100	27	AD/B	•
SK50.160.NK.16.ADB	SK50	16	32	160	17	AD/B	•
SK50.160.NK.22.ADB	SK50	22	40	160	19	AD/B	•
SK50.160.NK.27.ADB	SK50	27	48	160	21	AD/B	•
SK50.160.NK.32.ADB	SK50	32	58	160	24	AD/B	•
SK50.160.NK.40.ADB	SK50	40	70	160	27	AD/B	•

dodávka: s upínacím šroubem, unašecím kroužkem a perem

delivery: with retaining screw, driving ring and feather key