



# Upínač tepelný 4,5° s chladicími kanály

## Shrink chucks 4,5° with coolant channels



pro upínání nástrojů se stopkou TK a HSS  
for mounting of solid carbide and HSS-tool shanks

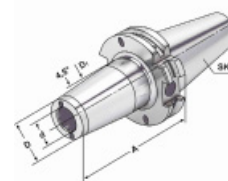

Název Catalog number	Kužel Taper	d	D	D <sub>1</sub>	l <sub>1</sub>	l <sub>2</sub>	A		G 2,5 25.000 min <sup>-1</sup>
SK40.80.TK4.06.ADB	SK40	6	21	27	36	10	80	AD/B	•
SK40.120.TK4.06.ADB	SK40	6	21	27	36	10	120	AD/B	•
SK40.80.TK4.08.ADB	SK40	8	21	27	36	10	80	AD/B	•
SK40.120.TK4.08.ADB	SK40	8	21	27	36	10	120	AD/B	•
SK40.80.TK4.10.ADB	SK40	10	24	32	41	10	80	AD/B	•
SK40.120.TK4.10.ADB	SK40	10	24	32	41	10	120	AD/B	•
SK40.80.TK4.12.ADB	SK40	12	24	32	46	10	80	AD/B	•
SK40.120.TK4.12.ADB	SK40	12	24	32	46	10	120	AD/B	•
SK40.80.TK4.14.ADB	SK40	14	27	34	46	10	80	AD/B	•
SK40.120.TK4.14.ADB	SK40	14	27	34	46	10	120	AD/B	•
SK40.80.TK4.16.ADB	SK40	16	27	34	49	10	80	AD/B	•
SK40.120.TK4.16.ADB	SK40	16	27	34	49	10	120	AD/B	•
SK40.80.TK4.18.ADB	SK40	18	33	42	49	10	80	AD/B	•
SK40.120.TK4.18.ADB	SK40	18	33	42	49	10	120	AD/B	•
SK40.80.TK4.20.ADB	SK40	20	33	42	51	10	80	AD/B	•
SK40.120.TK4.20.ADB	SK40	20	33	42	51	10	120	AD/B	•
SK40.100.TK4.25.ADB	SK40	25	44	53	57	10	80	AD/B	•
SK40.100.TK4.32.ADB	SK40	32	44	53	61	10	120	AD/B	•
SK50.80.TK4.06.ADB	SK50	6	21	27	36	10	80	AD/B	•
SK50.80.TK4.08.ADB	SK50	8	21	27	36	10	80	AD/B	•
SK50.80.TK4.10.ADB	SK50	10	24	32	41	10	80	AD/B	•
SK50.80.TK4.12.ADB	SK50	12	24	32	46	10	80	AD/B	•
SK50.80.TK4.14.ADB	SK50	14	27	34	46	10	80	AD/B	•
SK50.80.TK4.16.ADB	SK50	16	27	34	49	10	80	AD/B	•
SK50.80.TK4.18.ADB	SK50	18	33	42	49	10	80	AD/B	•
SK50.80.TK4.20.ADB	SK50	20	33	42	51	10	80	AD/B	•
SK50.100.TK4.25.ADB	SK50	25	44	53	57	10	100	AD/B	•
SK50.100.TK4.32.ADB	SK50	32	44	53	61	10	100	AD/B	•

l<sub>1</sub> = maximální upínací délka (clamping, depth, max.)

pro průměry stopek 3, 4 a 5 mm pouze pro karbidové nástroje

for Ø 3, 4 and 5 mm only solid carbide tool shanks must be used

l<sub>2</sub> = maximální délkové nastavení (length adjustment range max.)